# Safety Bulletin 04/2024



**July 2024** 

#### **Emergency Power Supply Testing**

This update is issued to raise awareness of the potential risk of testing of automatic start of emergency source of electrical power and connection to the emergency switchboard (SOLAS Ch. II-1, Regulation 42 / 43) using simulated blackout method.

This safety update is for:

- Ship Operators and Shipmasters
- Classification Societies, Maritime Administrations, their officers, investigators and technical advisors



# Attention Ship Operators, shipmasters, and Classification Societies



There have been numerous observations by PSCOs where the "simulated blackout" testing of the Emergency Generator is demonstrated as fully functional, but during an actual power blackout, the system does not meet the requirements of SOLAS Ch. II-1, Reg. 42 / 43.





# Be aware of risk, take precautions and comply with SOLAS requirements

#### SOLAS Ch. II-1 Reg 42.3.1.2 / 43.3.1.2

The emergency source of electrical power *shall start automatically* upon failure of the electrical supply from the main source of electrical power and *shall be automatically connected to the emergency switchboard*(...).

#### SOLAS Ch. II-1 Reg 42.7 / 43.7

Provision shall be made for the periodic testing of the complete emergency system and shall include the testing of automatic starting arrangements

#### **Common Shipboard Practice**


#### Use of "Sequence Test" or "Routine Test Switch (RTS)" for testing emergency generator

In meeting the requirements of SOLAS Chapter II-1 Regulation 42.7 / 43.7, many if not most ships, in undertaking routine testing in accordance with their preventative maintenance procedures, make use of a "Sequential test" selector and/or "Routine Test Switch" (RTS) for the testing of the emergency generator.

It has been identified these simulated blackouts use a different logic than when a 'controlled' blackout is performed.

Therefore, the actual circuits, relays, and Printed Circuit Boards when used in a real situation are not tested during routine maintenance to demonstrate SOLAS operational requirements.



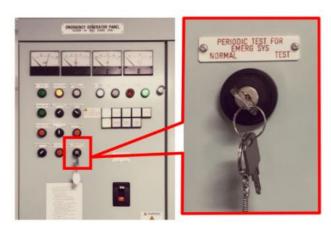



#### What has been observed by Port State Control Officers?

PSCOs have observed an alarming number of ships that were able to demonstrate a satisfactory test of the emergency generator utilizing a Sequence Test or RTS, but when tested by opening the Main Switch Board (MSB) Bus Tie (controlled blackout), the emergency generator was unable to:

- 1) automatically start; or
- 2) provide transitional power; or
- 3) automatically connect to the emergency switchboard.

As such, these simulated blackout tests of the emergency generator may not meet the requirements of SOLAS Ch. II-1, Reg. 43.7, and more importantly, give ships' engineers a false sense of readiness of the ship's emergency systems in the case an emergency. This may endanger life, ship, and the environment.

#### Recommendations

#### **ISM Management companies should:**

- 1. Ensure that any device such a "Sequential test" selector and/or "Routine Test Switch" (RTS), fitted to the ship for the purposes of testing the simulation blackout test are designed and wired in such a way as to use the actual circuit paths used to meet the requirements SOLAS is Chapter II-1, Reg 42.3.1.2 / 43.3.1.2, so as to test the system completely;
- Update Company Safety Management Procedure (SMS) for emergency generator test procedures to include periodic 'Controlled blackout tests' (i.e. not using sequence test) to ensure the actual circuit paths required by SOLAS is Chapter II-1, Reg 42.3.1.2 / 43.3.1.2, can be accomplished a safe and practical manner, while assuring functionality of the system.
  - Example: 'Controlled blackout' may be accomplished by opening MCR bus-tie (aka transfer line) circuit breaker, while the switch is in normal mode, and operation switches are in auto such as to be in a sea-going state.
- 3. Be aware that "Sequential test" selector and/or "Routine Test Switch" (RTS), may not meet the requirements of SOLAS Chapter II-1 Reg. 42.5.4 / 43.5.4 if it sends a signal to disconnect the inter-connector instead of automatically disconnecting on loss of main source of power, and do not meet Chapter II-1 Reg. 42.7 / 43.7 when not testing the complete system.



## Flag State Authorities, Classification Societies, and ISM Recognized Organizations should:

- Taking into account the information above, during routine inspections, surveys, and/or ISM audits, ensure that the emergency generator functionality is tested both by utilizing any "simulated blackout" routine/sequential test switch <u>and</u> a controlled a blackout (as described in (2) above). If a discrepancy is noted i.e. test is satisfactory during simulated black out during use "test switch" but unsatisfactory during controlled blackout then appropriate actions should be taken either through amending emergency generator test procedure or assuring test switch circuit paths allow for a full and complete test of the emergency generator.
- If modifications of routine/sequential test switch circuit paths are required to ensure proper functionality, these modifications should be approved by Classification Society / Recognized Organization. Any amendments to the emergency generator testing procedure should be documented through the ship's safety management system and preventative maintenance system.
- Take note that electrical system design and approval is the responsibility of the cognizant Recognized Organization / Classification Society, to ensure that at a minimum the system complies with the requirements of SOLAS.

#### **Tokyo MOU**

The memorandum of Understanding on Port State Control in the Asia-Pacific Region, known as the Tokyo MOU, was signed among eighteen maritime Authorities in the region on 1<sup>st</sup> December 1993 and came into operation on 1<sup>st</sup> April 1994. Currently, the Memorandum has 22 full members.

#### **Tokyo MOU Secretariat**

Ascend Shimbashi 8F, 6-19-19, Shimbashi, Minato-ku, Tokyo Japan 105-0004

Tel: +81-3-3433 0621 Fax: +81-3-3433 0624

Email: secretariat@tokyo-mou.org Website: www.tokyo-mou.org

